



parweld

APT+M 220C

OPERATOR MANUAL

ISSUE 1

Welcome

Thank you and congratulations on choosing Parweld. This Owner's Manual is designed to help you get the most out of your Parweld products. Please take time to read the Safety precautions. They will help you protect yourself against potential hazards in the workplace. With proper maintenance this equipment should provide years of reliable service. All our systems conform to ISO9001: 2015 and are independently audited by NQA.

The entire product range carries the CE and UKCA mark, and is constructed in accordance with European directives and the product specific standards where they apply.

Further Information

Parweld is the UK's leading supplier of MIG, TIG and Plasma torches and consumables. For more information about Parweld's complete range visit: www.parweld.com



parweld.com



[@ParweldLtd](https://twitter.com/ParweldLtd)



[ParweldTV](https://www.youtube.com/ParweldTV)



[parweld_uk](https://www.instagram.com/parweld_uk)

1.0 Safety Precautions	4	6.9 MIG Wire tension	16
2.0 Product Description	5	6.10 Welding Circuit Calibration	16
3.0 Technical Specifications	6	7.0 MMA Welding	16
3.1 Environmental Conditions	6	Output Polarity Connections	16
3.2 Operating data	6	7.1 MMA Operation	16
3.3 Duty Cycle	6	7.2 MMA VRD	16
3.4 Installation and positioning	6	7.3 MMA welding guide	17
3.5 Power supply	7	8.0 TIG Welding Guide	17
3.6 Generator operation	7	8.1 TIG welding cable connection	17
3.7 System Components	7	8.2 Torch starting in LIFT-TIG mode	17
4.0 Job List, Setting table	9	8.3 Additional TIG functions	17
5.0 Installation	10	9.0 ARC Air Gouging.	18
5.1 Unpacking the Machine	10	10.0 Additional Functions	18
5.2 Location	10	10.1 Memory function	18
5.3 Input and Grounding Connection	10	10.2 Supervisor Lock	19
5.4 Output Polarity Connections	10	10.3 Sleep Mode	19
5.5 Liquid Cooling	10	11.0 Function List	18
5.6 Shielding Gas Connection	10	12.0 Fault Finding	20
5.7 Gas Testing	10	13.0 Repair and Maintenance	22
5.8 Changing Drive Roll Sets	11	13.1 Error codes	23
5.9 Welding Wire Installation	11	14.0 Accessories	24
5.10 Torch Installation	11	14.1 Gas Equipment	24
5.11 Work Return Lead Connection	12	14.2 Feed Rolls	24
6.0 Operation- MIG	12	15.0 EC Declaration of Conformity	25
6.1 Operation Selecting the JOB	12	15.1 RoHS Compliance Declaration	25
6.2 Manual MIG welding	13	15.2 WEEE Statement	26
6.3 Trigger modes (2T)	13	15.3 Statement of Warranty	26
6.4 Trigger mode (4T)	13		
Trigger mode (S2T, S4T)	13		
S4T step current	13		
6.6 Operation Smart Trigger	13		
6.7 MIG Special Processes	15		
APT+ Cold	15		
APT+Root	15		
APT+ Deep	15		
APT+Stabi	15		
6.8 Trimming the Arc.	15		
Voltage trim	15		
Arc-force dynamic correction	15		

1.0 Safety Precautions

ELECTRIC SHOCK can kill.

Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.

Do not touch live electrical parts.

Wear dry, sound insulating gloves and body protection.

Insulate yourself from work and ground using dry insulating mats or covers big enough to prevent any physical contact with the work ground.

Additional safety precautions are required when any of the following electrically hazardous conditions are present: in damp locations or while wearing wet clothing; on metal structures such as floors, gratings, or scaffolds; when in cramped positions such as sitting, kneeling, or lying; or when there is a high risk of unavoidable or accidental contact with the work piece or ground. For these conditions, use the following equipment in order presented:

- 1) a semiautomatic DC constant voltage (wire) welder,
- 2) a DC manual (stick) welder and do not work alone!

Disconnect input power before installing or servicing this equipment. Lockout/tagout input power according to Safety Standards.

Properly install and ground this equipment according to national and local standards.

Always verify the supply ground - check and ensure that input power cable ground wire is properly connected to ground terminal in the receptacle outlet.

When making input connections, attach proper grounding conductor first - double-check connections.

Frequently inspect input power cable for damage or bare wiring - replace cable immediately if damaged - bare wiring can kill.

Turn off all equipment when not in use.

Do not use worn, damaged, under sized, or poorly spliced cables.

Do not drape cables over your body.

If earth grounding of the work piece is required, ground it directly with a separate cable.

Do not touch electrode if you are in contact with the work, ground, or another electrode from a different machine.

Use only well-maintained equipment. Repair or replace damaged parts at once. Maintain unit according to manual.

Wear a safety harness if working above floor level.

Keep all panels and covers securely in place.

Clamp work cable with good metal-to-metal contact to work piece or worktable as near the weld as practical.

Insulate work clamp when not connected to work piece to prevent contact with any metal object.

Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

FUMES AND GASES can be hazardous.

Keep your head out of the fumes. Do not breathe the fumes. Ventilate the area and use local forced ventilation at the arc to remove welding fumes and gases.

If extraction is poor, wear an approved respirator.

Read and understand the Material Safety Data Sheets (MSDS's) and the manufacturer's instructions for metals, consumable, coatings, cleaners and de-greasers.

Work in a confined space only if it is well ventilated, or while wearing an air-supplied respirator. Always have a trained watch person nearby. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.

Do not weld in locations near de-greasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapours to form highly toxic and irritating gases.

Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.

ARC RAYS can burn eyes and skin.

Arc rays from the welding process produce intense, visible and invisible (ultraviolet and infrared) rays that can burn eyes and skin. Sparks fly off from the weld.

Wear an approved welding helmet fitted with a proper shade of filter lenses to protect your face and eyes when welding or watching

Wear approved safety glasses with side shields under your helmet.

Use protective screens or barriers to protect others from flash, glare and sparks; warn others not to watch the arc.

Wear protective clothing made from durable, flame resistant material (leather, heavy cotton, or wool) and foot protection. Welding on closed containers, such as tanks, drums, or pipes, can cause them to blow up. Sparks can fly off from the welding arc. The flying sparks, hot work piece, and hot equipment can cause fires and burns. Accidental contact of electrode to metal objects can cause sparks, explosion, overheating, or fire. Check and be sure the area is safe before doing any welding.

WELDING can cause fire or explosion.

Remove all flammables within 10m of the welding arc. If this is not possible, tightly cover them with approved covers.

Do not weld where flying sparks can strike flammable material.

Protect yourself and others from flying sparks and hot metal.

Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas.

Watch for fire, and keep a fire extinguisher nearby. Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.

Do not weld on closed containers such as tanks, drums, or pipes, unless they are properly prepared according to local regulations

Connect work cable to the work as close to the welding area as practical to prevent welding current from travelling along, possibly unknown paths and causing electric shock, sparks, and fire hazards.

Cut off welding wire at contact tip when not in use.

Wear oil-free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap. Remove any combustibles, such as a butane lighter or matches, from your person before doing any welding.

FLYING METAL can injure eyes.

Welding, chipping, wire brushing, and grinding cause sparks and flying metal. As welds cool they can throw off slag. Wear approved safety glasses with side shields even under your welding helmet.

BUILDUP OF GAS can injure or kill.

Shut off shielding gas supply when not in use. Always ventilate confined spaces or use approved air-supplied respirator.

HOT PARTS can cause severe burns.

Do not touch hot parts with bare handed.

Allow cooling period before working on gun or torch.

To handle hot parts, use proper tools and/or wear heavy, insulated welding gloves and clothing to prevent burns.

MAGNETIC FIELDS can affect pacemakers.

Pacemaker wearers keep away.

Wearers should consult their doctor before going near arc welding, gouging, or spot welding operations.

NOISE can damage hearing.

Noise from some processes or equipment can damage hearing.

Wear approved ear protection if noise level is high.

Shielding gas cylinders contain gas under high pressure.

CYLINDERS can explode if damaged.

Protect compressed gas cylinders from excessive heat, mechanical shocks, physical damage, slag, open flames, sparks, and arcs. Install cylinders in an upright position by securing to a stationary support or cylinder rack to prevent falling or tipping. Keep cylinders away from any welding or other electrical circuits. Never drape a welding torch over a gas cylinder. Never allow a welding electrode to touch any cylinder. Never weld on a pressurized cylinder - explosion will result. Use only correct shielding gas cylinders, regulators, hoses, and fittings designed for the specific application; maintain them and associated parts in good condition.

Turn face away from valve outlet when opening cylinder valve.

Use the right equipment, correct procedures, and sufficient number of persons to lift and move cylinders.

Read and follow instructions on compressed gas cylinders, associated equipment, and Compressed Gas Association (CGA).





 



 



 
 


 
 

 

 
 







2.0 Product Description

The APT+M220C is a complete semiautomatic constant voltage DC arc welding machine built to meet CE specifications. It combines a constant voltage power source and a constant speed wire feeder with a microcomputer-based controller to form a reliable high-performance welding system. A simple control scheme, consisting of voltage and wire feed speed controls, provides versatility with ease of use and accuracy. Other features include wire reel spindle with adjustable brake for 15kg wire spools (300mm), no undercarriage on 200, an adjustable Argon flow regulator with cylinder pressure gauge and inlet hose, a Parweld MIG torch, and a 3.0m work cable with clamp.

3.0 Technical Specifications

 The APT+M220C is a compact type of machine with integrated wire feed unit for use with single phase 230V. The machine uses inverter technology to allow MIG, TIG and MMA welding to be performed.

4.0 Description of Controls



1		12		22		31	—	40	Hz
2		13		23		32	U_0	41	
3		14		24		33	U_1	42	
4		15		25		34	U_2	43	X
5		16		26	A	35	I_{1eff}	44	
6		17		27	V	36	I_{1max}	45	○
7		18		28		37	I_2		
8		19		29		38	%		
9		20		30	+	39			
10		21							
11									

4.1 Symbols and Definitions

- | | |
|---|---|
| 1. Manual Metal Arc welding | 23. Internal combustion engine |
| 2. TIG welding | 24. Motor |
| 3. MIG welding | 25. Belt drive |
| 4. Self-shielded flux-core arc welding | 26. Amps |
| 5. Submerged arc welding | 27. Voltage |
| 6. Plasma cutting | 28. Voltage input |
| 7. Arc gouging | 29. Voltage output |
| 8. Plasma welding | 30. Positive |
| 9. Direct current | 31. Negative |
| 10. Alternating current | 32. Open circuit voltage |
| 11. Accurate or alternating current at the same output and additional frequency of Hz | 33. Mains voltage |
| 12. Single-phase transformer | 34. Load voltage |
| 13. Three phase transformer with rectifier | 35. Maximum current drawn from the supply |
| 14. Single or three-phase static frequency inverter - transformer - rectifier | 36. Maximum line current under load |
| 15. AC or DC Inverter power supply | 37. Welding current under load |
| 16. Three-phase motor - generator | 38. Percent |
| 17. Three-phase motor - generator - rectifier | 39. Suitable for environments with increased risk of electric shock |
| 18. Three-phase rotary frequency inverter | 40. Hertz |
| 19. Single-phase combined AC and DC power unit | 41. Temperature |
| 20. Internal combustion engine - generator | 42. Increment / Decrease setting |
| 21. Internal combustion engine - generator - rectifier | 43. Duty Cycle |
| 22. Supply circuit, number of phases (eg 1 or 3), alternating current symbol and declared frequency (eg 50 Hz or 60 Hz) | 44. On |
| | 45. Off |

4.2 Description of the Machine


1. Handle
2. Welding Torch Connection
3. Machine Feet mounting locations
4. Connection Socket for electrode
5. Welding machine control panel and protective cover
6. Wire feed box door

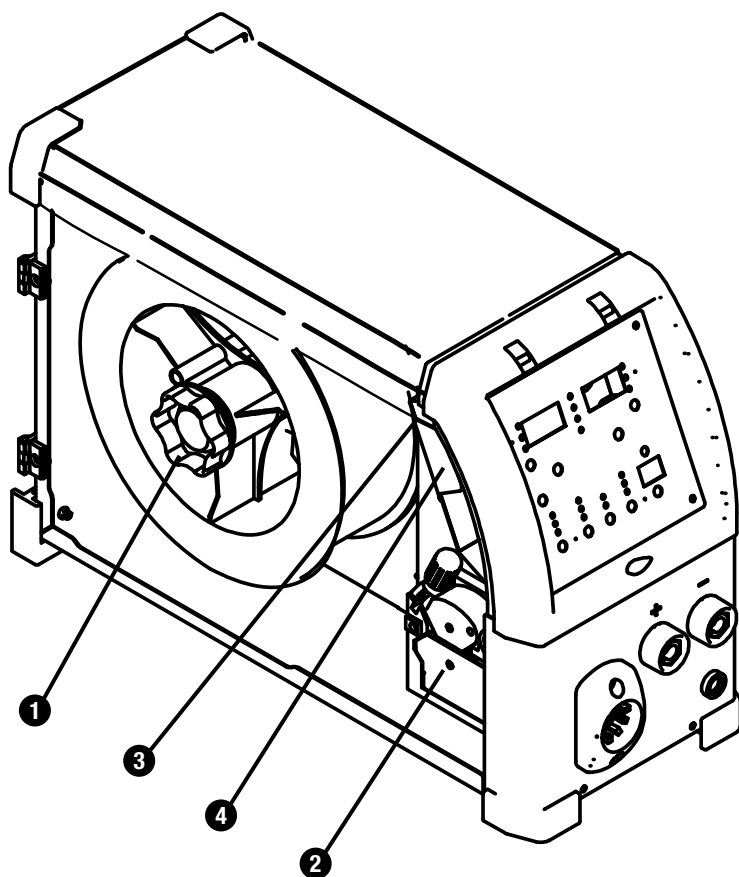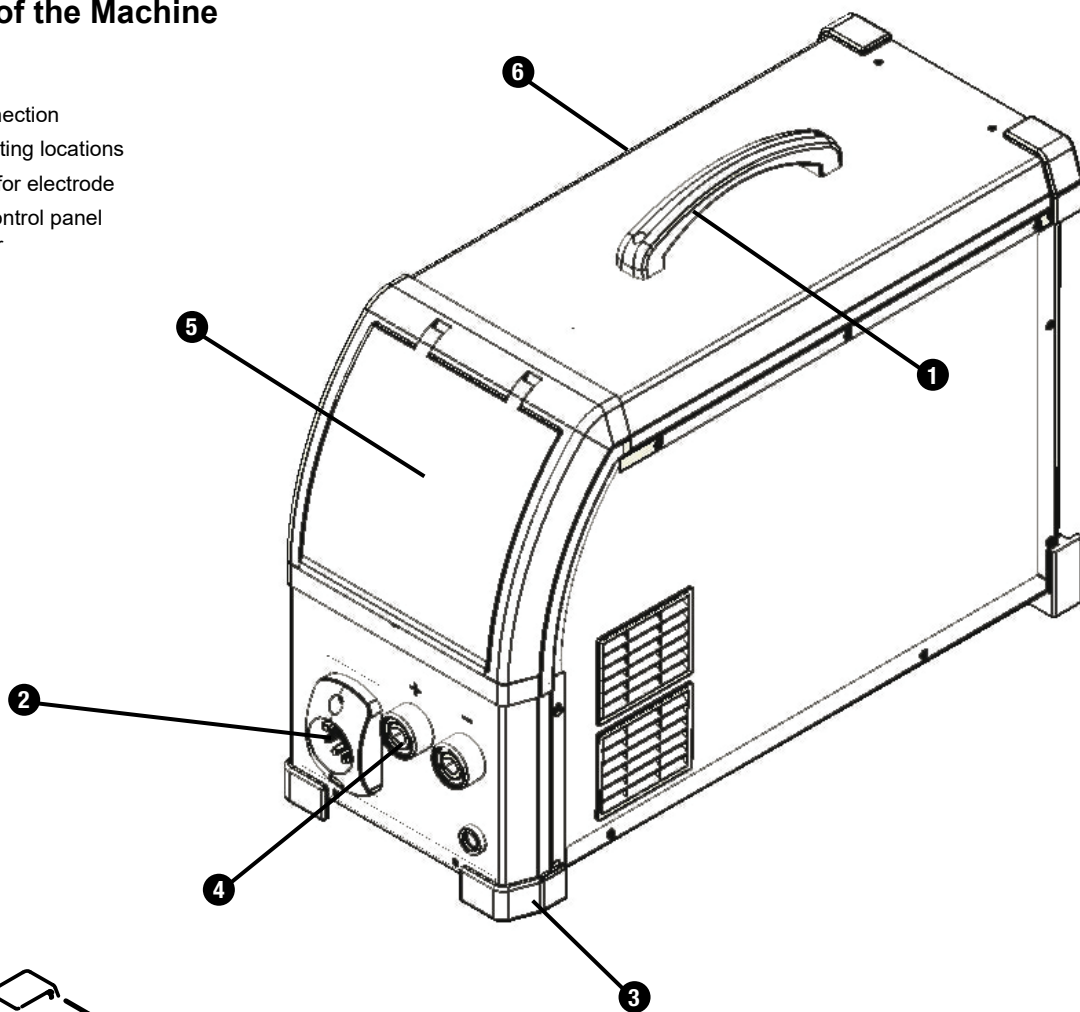

Internal View

1. Wire spool hub
2. Wire feed box
3. Wire loading button
4. Gas test button

4.3 Device Control

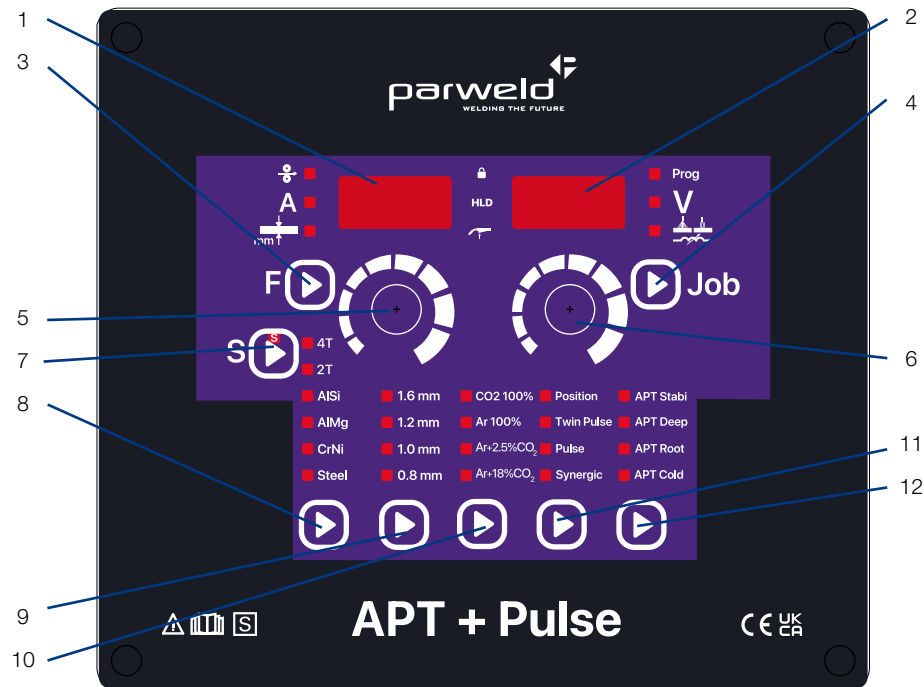

1. Multifunction display for wire speed, Amperage and material thickness. Also displays the Function number.
2. Multifunction display for Program Memory, Voltage and Dynamic arc force correction. Also displays the Job Number.
3. Function button, a short press toggles the display between wire speed, Amperage and material thickness as indicate by the LED at the side of the display. A long press (3 seconds) brings up the function display.
4. JOB button, a short press toggles the display between Program Memory, Voltage and Dynamic arc force correction as indicate by the LED at the side of the display. A long press (3 seconds) brings up the JOB display.
5. Selection knob left, allows adjustment of any parameter displayed in the left Multifunction Display
6. Selection knob right, allows adjustment of any parameter displayed in the right Multifunction Display
7. Trigger mode Enables 2T, 4T, S2T and S4T. For application refer to the page number 15
8. Welding material selection, allows toggling of the welding material to be welded
9. Welding wire diameter selection allows toggling of the wire diameter, please note not all wire diameters can be selected depending upon the other selection of process gas type etc.
10. Welding gas selection allows toggling of the gas type, please note not all gas types can be selected depending upon the other selections of material type, wire size etc.
11. Welding mode selection allows toggling of the welding mode , please note not all welding modes can be selected depending upon the other selections of material type, wire size , gas type etc.
12. Special process, allows the selection of special processes which work alongside the other settings

4.0 Job List, Setting table

Located inside the door of the wire feeder This lists all the JOBS and Functions which can be selected from the front panel.

Job list, jobs can be loaded using the JOB number or by selecting parameters on the front panel. MMA, Gouging and TIG welding must be selected using the JOB number

APT Synergic - Pulse		0.8	1.0	1.2
SG2 / SG3 G3Si1 / G4Si1	Ar+18%CO ₂	8	10	12
	Ar+10%CO ₂	18	20	22
	CO ₂ 100	28	30	32
318 / 1.4576 316 / 1.4430 310 / 1.4842 309 / 1.4332 308 / 1.4316 307 / 1.4370 Duplex 2209 1.4462	Ar+2.5%CO ₂	38	40	42
		68	70	72
		520	522	
		538	540	542
		58	60	62
		48	50	52
		78	80	82
Ar+20%He+2%CO ₂	88	90	92	
CuSi	Ar100%	178	180	182
	Ar+2.5%CO ₂	558	560	562
CuAl	Ar100%	188	190	192
	Ar100%	198	200	202
CuSi Brazing	Ar+2.5%CO ₂	208	210	212
	Ar100%	218	220	222
CuAl Brazing	Ar+2.5%CO ₂	228	230	232
	Ar100%	118	120	122
AlMg4,5 Mn	Ar+30%He	128	130	132
	Ar100%	530	532	
AlMg3	Ar100%	138	140	142
	Ar+30%He	148	150	152
AlSi	Ar100%	158	160	162
	Ar+30%He	168	170	172
Al99	Ar100%	178	180	182
	Ar+30%He	188	190	192
APT Deep - Pulse		0.8	1.0	1.2
SG2 / SG3 G3Si1 / G4Si1	Ar+18%CO ₂	298	300	302
	Ar+10%CO ₂	308	310	312
	CO ₂ 100	318	320	322
318 / 1.4576 316 / 1.4430 310 / 1.4842 309 / 1.4332 308 / 1.4316 307 / 1.4370 Duplex 2209 1.4462	Ar+2.5%CO ₂	620	622	
		640	642	
		660	662	
		670	672	
		320	322	
		630	632	
		650	652	
AlMg4,5 Mn	Ar100%		332	
AlSi	Ar100%		342	
Al99	Ar100%		352	
CrNi / FluxCore Metal	Ar+18%CO ₂	608	610	612
APT Root - Pulse		0.8	1.0	1.2
SG2 / SG3 G3Si1 / G4Si1	Ar+18%CO ₂	360	362	
	CO ₂ 100%	370	372	
	Ar+10%CO ₂	500	502	

APTCold - Pulse		0.8	1.0	1.2
SG2 / SG3 G3Si1 / G4Si1	Ar+18%CO ₂	378	380	382
	CO ₂ 100%	388	390	392
	Ar+10%CO ₂	510	512	
318 / 1.4576 316 / 1.4430 308 / 1.4316 307 / 1.4370 Duplex 2209 1.4462	Ar+2.5%CO ₂	678	680	682
		698	700	702
		398	400	402
		688	690	692
		708	710	712
		708	710	712
AlMg4,5 Mn	Ar100%	410	412	
AlSi	Ar100%	420	422	
Al99	Ar100%	430	432	
CuSi Brazing	Ar100%	438	440	442
CuAl Brazing	Ar100%	448	450	452
AlSi Brazing	Ar100%	460	462	
ZnAl Brazing	Ar100%	470	472	
ZnAl (St to Al Welding)	Ar100%	490	492	
Mg / Mg	Ar+30%He		572	
Cladding		0.8	1.0	1.2
NiCr-6625 / 2.4831	Ar+30%He	100	102	
	Ar+20%He+2%CO ₂	110	112	
NiCr-6617 / 2.4627	Ar+30%He		552	
CrNi / 309-2312 / 1.4332	Ar+2.5%CO ₂		542	
Co - Based	Ar100%		532	
APT Stabi		0.8	1.0	1.2
SG2 / SG3 - G3Si1 / G4Si1	Ar+18%CO ₂	730	732	
	Ar+2.5%CO ₂	750		
CrNi - 316 / 1.4430	Ar+2.5%CO ₂		740	742
CrNi - 308 / 1.4316	Ar+2.5%CO ₂		740	742
Flux Cored Wire		0.8	1.0	1.2
Steel / FluxCore Metal	Ar+18%CO ₂	238	240	242
	Ar+18%CO ₂	248	250	252
Steel / FluxCore Rutil	CO ₂ 100		262	
	Ar+18%CO ₂		602	
Steel / FluxCore Basic	Ar+18%CO ₂		602	
	Ar+2.5%CO ₂		272	
CrNi / FluxCore Metal	Ar+18%CO ₂		282	
	Ar+18%CO ₂		282	
CrNi / FluxCore Rutil	CO ₂ 100%		292	
	Ar+18%CO ₂		592	
Steel FluxCore High Str.	Self Shielded		720	722
Application				
MIG/MAG Manual		4		
TIG (Lift Arc)		5		
MMA		6		
Gouging		7		

Function


Pictogram

indicates the

purpose of the

Key function

buttons

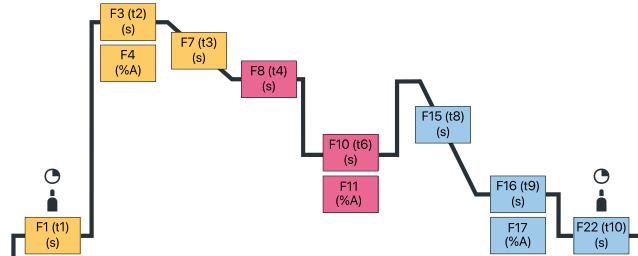

Function list,

Functions can

be loaded using

the F number

Function	Description	Min	Max	Unit
F1	Gas Pre-flow (t1)	0	10	Seconds
F2	Start Ignition Mode	0	2	-
F3	Start Time (t2)	0	10	Seconds
F4	Start Amper %	1	200	%
F5	Start Arc Correction	-9.9	+9.9	Volts
F7	Start Slope (t3)	0	5	Seconds
F8	Duo Peak Time (t4)	0	10	Seconds
F10	Duo Base Time (t6)	0	10	Seconds
F11	Duo Base Amper %	1	100	%
F12	Duo Base Arc Correction	-9.9	+9.9	Volts
F15	End Down Slope (t8)	0	10	Seconds
F16	End Time (t9)	0	10	Seconds
F17	End Amper %	1	200	%
F18	End Arc Correction	-9.9	+9.9	Volts
F20	End Burn Back	10	200	-
F21	End Wire Cut Mode	0	2	-

Function	Description	Min	Max	Unit
F25	Hot Start Time	0	10	Seconds
F26	Hot Start Amper %	1	200	%
F27	Arc Force	-50	+50	%
F28	Antistick	0	2	Seconds

Function	Description	Min	Max	Unit
F31	TIG V Stop Limit	10	30	Volts
F32	TIG Comfort Stop Sensitivity	-2	+2	Volts

Function	Description	Min	Max	Unit
F35	Other Cooling Mode	0	3	-
F36	Motor Current	0	3	A
F37	Motor Control Firmware	0	3	-
F38	Power Control Firmware	-	-	-
F39	Arc time	-	-	h
F40	Total operating hours	-	-	h
F50	RL Cable Calibration	7		mOhm

Parweld reserves the right to change or update the JOBS and Functions through software updates in the machine that may not be reflected on this list. The limited power output of the APT+M220C may mean not all functions are available in a particular wire size.

5.0 Installation

Read entire installation section before starting installation.

SAFETY PRECAUTIONS

- ELECTRIC SHOCK can kill.
- Only qualified personnel should perform this installation.
- Only personnel that have read and understood the Operating Manual should install and operate this equipment.
- Machine must be grounded per any national, local or other applicable electrical regulations.
- The MIG power switch is to be in the OFF position when installing work cable and torch and when connecting other equipment.

5.1 Unpacking the Machine

Cut banding and lift off cardboard carton. Cut banding holding the machine to the skid. Remove corrugated packing material. Remove accessories from Gas Bottle Platform. Roll the machine off the skid.

5.2 Location

Locate the welder in a dry location where there is free circulation of clean air into the louvres in the back and out the front. A location that minimizes the amount of smoke and dirt drawn into the rear louvres reduces the chance of dirt accumulation that can block air passages and cause overheating.

5.3 Input and Grounding Connection

WARNING

Before starting the installation, check that your power supply is adequate for the voltage, amperage, phase, and frequency specified on the Machine nameplate.

Ensure that you connect a plug that is suitably rated for the power draw of the machine and the environmental location.

Have a qualified electrician connect the input plug. For long runs over 30m, larger copper wires should be used. The green/yellow wire in the input cable connects to the frame of the machine. This ensures proper grounding of the machine when the machine plug is inserted into the receptacle.

5.4 Output Polarity Connections

MIG, TIG and MMA welding use different electrode polarities.

5.5. Torch Cooling (option)

Coolant liquids!

The use of unsuitable coolants will result in damage and void the manufacturer's warranty!

- Only use the coolants specified in this manual.
- Do not mix different coolants.
- Replace the entire fluid when changing the coolant.

Insufficient antifreeze in the welding torch coolant can damage the machine. The coolant must be checked at regular intervals for the amount of antifreeze and thus avoid any damage to the machine and its accessories.

Only Use Parweld XTSUC Coolant

ATTENTION

Machine damage can be caused by improperly connected coolant lines!

In the case of improperly connected coolant lines or if a gas-cooled welding torch is used, the cooling circuit is interrupted and machine damage may occur.

- Connect all cooling lines properly!
- Complete the hose package and the torch hose package.
- Pay attention to the maximum hose package length!
- If using a gas-cooled welding torch, disconnect the cooling unit at the rear of the machine.

5.6 Cable and Torches

WARNING

- The welding power cables that are improperly installed can cause faults on the arc!
- In order to avoid mutual interactions. Observe the minimum distance of 20 cm between torch and work lead.
- Use a separate work return cable for each welding machine.
- Fully uncoil welding current lines, welding torches.
- Cable lengths should not be longer than required.

5.7 Gas Testing

- Open the gas cylinder valve slowly.
- Open the pressure reducer.
- Switch on the power supply from the main switch.
- Press the gas test function on the wire feeder.
- Adjust the amount of gas in the flow meter according to the application.
- The gas test is activated by briefly pressing the button on the wire feed unit. The shielding gas flows for about 25 seconds or until the button is pressed again.

Setting the amount of shielding gas welding method recommended amount of shielding gas

MAG welding Wire diameter x 11.5 = l / min

MIG brazing Wire diameter x 11.5 = l / min

MIG welding (aluminium) Wire diameter x 13.5 = l / min

(100% argon) Gas nozzle diameter in TIG mm is equal to l / min gas flow

Incorrect protective gas adjustment!

A too low or too high a shielding gas setting can cause air to reach the welding pool, resulting in the formation of pores.

- Adjust the shielding gas amount according to the welding task!

Source information display.

The "Parameter selection" keys are located on the left and right of the machine control unit. These keys are used to select the source parameters shown.

Each time the button is pressed, the display changes to the next parameter (the LEDs next to the key indicate the selection). Once the last parameter is reached, the first parameter is restarted.

The following are shown.

- Nominal Values (Before welding)
- Actual Values (During welding)
- Hold values (After welding)

5.8 Changing Drive Roll Sets

1. Turn off the power source.
2. Release the pressure on the idle rolls by swinging the adjustable pressure arm down. Lift the cast idle roll assembly and allow it to sit in an upright position.
3. Unscrew the plastic knob retaining the lower grooved drive roll and slide off the drive roller
4. Ensure the wire size marked on the side of the feed roller matches the wire size to be used.
5. Replace the drive rolls in reverse of the above procedure ensuring the wire size to be used is marked on the outward facing side of the roller as it is refitted.

NOTE:- Be sure that the torch liner and contact tip are also sized to match the selected wire size.

5.9 Welding Wire Installation

As a factory delivery, the Euro connection is equipped with a capillary tube for welding torches with spiral liners. If a welding torch with plastic liner is used the capillary tube should be removed.

- Use a steel guide tube to weld hard, unalloyed wire electrodes (steel).
- Use a chrome nickel guide spiral to weld hard, high-alloyed wire electrodes (CrNi).
- Use extension of torch liner for welding or soldering soft wire electrodes, high-alloy wire electrodes or aluminium materials.

Preparation for connecting welding torches with manual spirals:

- Check that the central connection is seated in the capillary tube!

Preparations for the connection of welding torches with torch liner extension.

- Push the capillary tube forward in the direction of the central connection by the wire feed and remove it here.
- Shorten the liner extension just before the wire feed roller with the a knife.
- Loosen the centre socket of the welding torch and pull it out.
- Clean and sharpen the separated end of the wire liner
- Open the wire feed cover by pulling the catches back.
- Unscrew the plastic retaining wheel from the end of the spool holder shaft.
- Position the wire spool so that it will rotate in a direction when feeding so as to be de-reeled from the bottom of the coil.
- Slide the wire spool all the way onto the shaft and refit the plastic retaining nut.

NOTE:- There is a friction brake on the reel hub assembly, to prevent the wire spool over running. When welding stops ensure the nut is slackened to the minimum setting. It can be adjusted by means of the nut visible when the plastic nut is removed.

- Turn the Spool until the free end of the electrode is accessible. While securely holding the electrode, cut off the bent end and straighten the first six inches. (If the electrode is not properly straightened, it may not feed properly through the wire drive system. Manually feed the wire from the wire reel and through the wire guide and then over the top of the wire feed rollers (ensure the pressure arms are in the raised position).
- Continue to feed the wire through the outlet guide until 20mm of wire is protruding from the front of the machine torch connector.
- Reposition the adjustable pressure arms to their original position to apply pressure. Adjust pressure as necessary.

NOTE:- The pressure arms should be adjusted in order to give the minimum amount of pressure on the wire to allow reliable feeding.

5.10 Torch Installation

- Insert the Euro connector of the welding torch into the Euro socket and screw tight with the hand nut.
- Fit the coolant hoses to the appropriate quick couplings: red (coolant backflow) and blue (coolant supply) if required.

Wire feed

Opening the door of the wire feeder drive

CAUTION

The door of the feed system must be opened for the following operations. The door must be closed again before starting work.

Loading the wire to the feed unit

CAUTION Risk of injury due to moving parts!

Wire feeders are equipped with moving parts that can trap hands, hair, clothes or tools and thus injure people!

- Do not handle rotating or moving parts or drive parts by hand!
- Keep the protective covers closed during operation! Risk of injury due to uncontrolled welding wire!

The welding wire can be feeding at high speed and can get out of control and injure people in the case of improper or incomplete wire feeding!

- Ensure full wire delivery from the wire coil to the welding torch before connecting to the mains!
- If the welding torch is not installed, unscrew the rollers of the wire feeder!
- Check the wire delivery at regular intervals!
- Keep all body covers and protective covers closed during operation!

Risk of injury due to welding wire feeding from the welding torch!

The welding wire can overflow the welding torch with a high speed and injure face and eyes with body parts!

- Never point the welding torch to your body and to the bodies of others!

ATTENTION


The wear on the wire feed rollers increases due to unsuitable roller pressure!

- In the setting nuts of the pressurized pressure units, it must be adjusted so that the wire electrode is stopped, but only when the wire feed is blocked!
- Adjust the press pressure of the front rollers (when viewed in the push direction) higher!
- The transmission speed can be infinitely adjustable by pressing the wire feed button and also by rotating the wire feed speed rotary knob. The selected feed rate is shown on the left display of the wire feed unit.
- Extend the torch straight while loading wire .

Your Parweld MIG/MAG Welding Torch has been supplied ready to weld. It has been supplied with the standard consumables denoted in the product brochure.

To connect the torch to the power source:-

1. Remove the tip adaptor and contact tip
2. Inch the wire from the exit of the wire guide on the feed unit as Figure 1. Ensure that it does not short out on any machine panels.

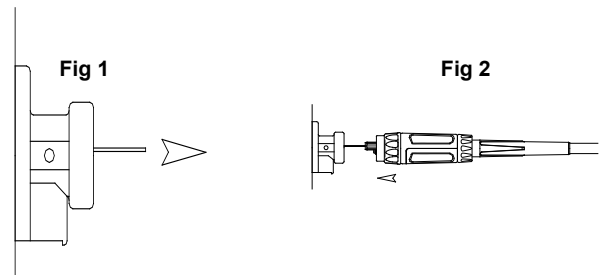

3. Carefully slide the electrode wire into the torch liner and slowly locate the torch gun plug body into the feed unit central connector and tighten the gun plug nut as Figure 2


NOTE:- To aid the initial location of a new torch and to prevent damage to the gas nipple O Ring a very light application of grease to the O Ring is beneficial.

4. Keeping the torch as straight as possible, use the power source inch facility or torch trigger to feed the electrode wire 50mm from the end of the liner conduit.
5. Once the electrode wire has stopped, refit the tip adaptor, diffuser, contact tip and gas nozzle.
6. Trim the electrode wire to within 5mm of the face of the nozzle, this will facilitate jolt free arc initiation.
7. Press the gas purge button and check the gas flow is adequate for your application.
8. An inexpensive flow meter is available from Parweld reference 806001.
9. If you are setting a water-cooled torch ensure you have the recommended water flow rate.

NOTE:- It is essential to ensure adequate flow of clean, cool water to prevent irreparable torch failure, a minimum of 1.2 l/min is recommended.

Note. Water flows into the torch through the blue hose. The blue hose delivers cold water directly to the prime source of heat, the swan neck and consumable. The re circulated water is then passed through the torch power cable to cool the power cable as it is returned to the cooler through the red water return lead.

Ensure all air is removed from the water cooling circuit before welding.

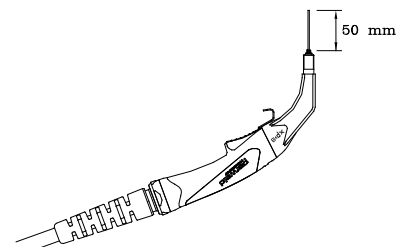

5.11 Work Return Lead Connection

Insert the work return lead connector into the (-) receptacle on the front panel of the machine and twist it clockwise until tightly secured.

Connect the earth clamp to the work piece as close as possible to the point to be welded and ensure that a good electrical connection is created to bare metal.

5.12 Shielding Gas Connection

1. Using the gas hose supplied connect the hose to the gas inlet connection on the rear of the machine and tighten it with a spanner.
2. Connect the opposite end of the gas hose to the output connection of a gas regulator capable of supplying the correct gas flow for the welding operation.

NOTE:- If the gas cylinder is to be stored on the back of the machine ensure it is secured using the retention chain provided.

6.0 Operation- MIG

Switch on the machine using the mains on/off switch, this lights the front panel.

You can MIG weld in multiple modes and the easiest way to select the correct welding mode is to use the buttons on the front panel; of the wire feeder

6.1 Operation Selecting the JOB


Select the material to be welded using button the toggle button **A**



Select the wire diameter that you have installed using the toggle button **B**



Press the "Shielding gas" button to select the shielding gas using toggle button **C**

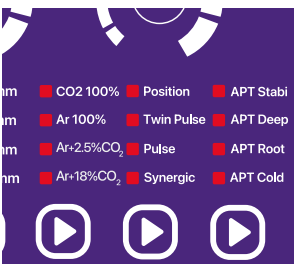


Press the "Process" toggle button D to select the desired MIG mode **Synergic (one knob control)**

Pulsed synergic welding (reduced spatter welding)

Twin Pulse synergic welding (reduced spatter with heat control)

Position synergic welding for welding out of position

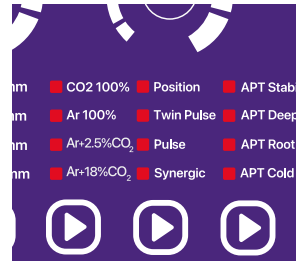

Alternatively you can select the required JOB by looking up the the job number on the table inside the wire feeder door and then press and hold the JOB button for 3 seconds, once JOB is displayed rotate the Right Selector knob until you reach you desired JOB number. The front panel will display your selection

With the correct material selected you can now simply dial in the welding power level using the parameter of you preference. Rotate the Left selector knob to increase or decrease the power level pressing the Function button will toggle the display between Amperage, wire speed or material thickness.


6.2 Manual MIG welding


The APT+ machine has a wide range of JOBS to suit many different materials and wire sizes which have been optimised to give the best welding results when using the Synergic Mode. If you wish to use the machine in manual mode.

Press and hold the JOB button for 3 seconds, once JOB is displayed rotate the Right Selector knob until you reach JOB 005 . In manual welding mode adjusting the Left hand knob alters the wire speed and adjusting the right hand know adjusts the voltage independently. You will need to adjust these settings until you find the desired stable parameters.

6.3 Trigger modes (2T)

Select 2T operation on the front panel by a short press on the toggle button. **E** until 2T is illuminated

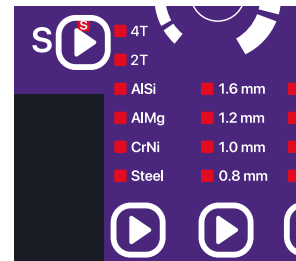


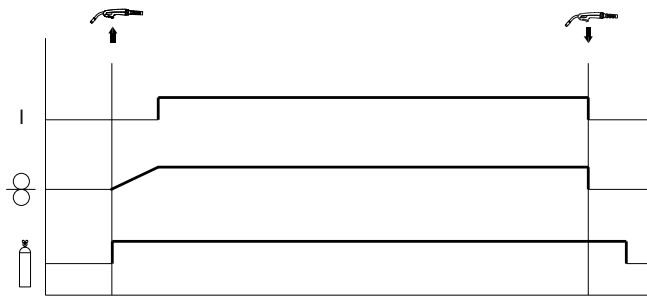

- Depress the trigger and hold on.
- Pre-gas will start (adjust with F1)
- Then arc will start
- At the end of the weld release the trigger and the arc stops.
- The wire stick out can be adjusted by changing burn back time (F20)
- The post gas flow can be adjusted as required (F22)

6.4 Trigger mode (4T)

Select **4T** operation on the front panel by a short press on the toggle button. **E** until **4T** is illuminated

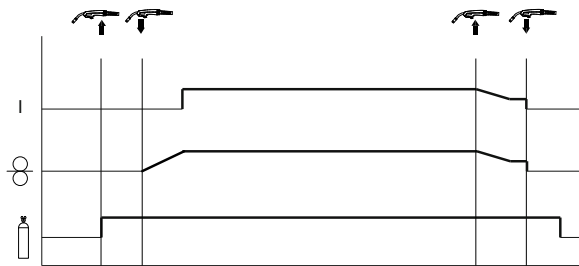


- Depress the trigger and hold
- Pre-gas will start and stay on (F1)
- Release the trigger the arc will start and continue
- At the end of the weld depress and hold the trigger, the final current will start (F17) and will stay on until the trigger is released which starts post gas (F22)

6.5 Trigger mode Special (S2T) (S4T)

Select **2T** or **4T** operation on the front panel by using a short press on the toggle button **E**. Then press and hold the toggle button **E** until the **S** LED above the button illuminates.

S2T


- Depress the trigger and hold on
- Pre-gas will start and stay on (F1)
- Hot start current will start (F4) and last for duration of F3
- The arc will change to the normal power level

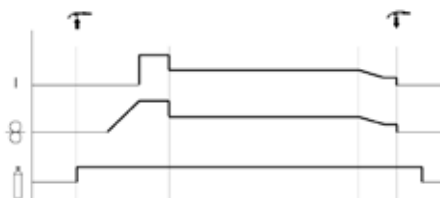

- Release the trigger
- The down slope will start (F15) and then final current (F17) and will stay on for duration of F16 which starts post gas (F22)

S4T


- Depress the trigger and hold
- Pre-gas will start and stay on (F1)
- Hot start current will start (F4)
- Release the trigger the arc will change to the normal power level using the ramp time (F7) and continues
- At the end of the weld depress and hold the trigger, the down slope will start (F15) and then final current (F17) and will stay on

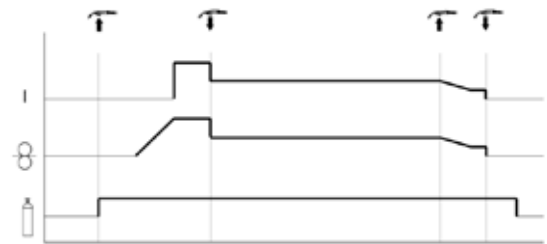

- until the trigger is released which starts post gas (F22)

S4T Step current

The main current period of welding a short press and release of the trigger will step the welding power down to the value of F11, a short press again will restore the main welding current

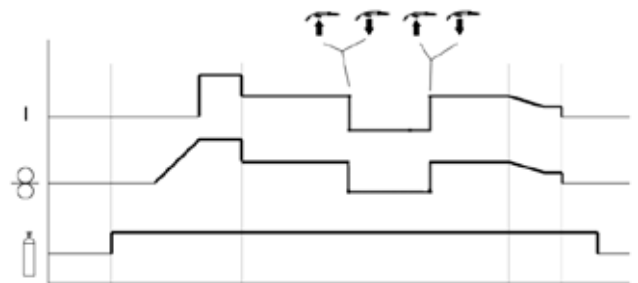

6.6 Operation Smart Trigger


Smart trigger allows the user to change memory programs quickly from the torch without having to return to the machine. Store the required programs starting at memory location 01, 02 etc.

Switch on the Smart trigger function .

Ensure the front panel of the machine is set to 4T or S4T operation.


Set the value of F23 to 01 to switch on smart trigger.

Now if you give the trigger a short double (less than 1 second each tap) it will select the next memory program within the first 3 memories. Another short press moves to the next memory location etc.

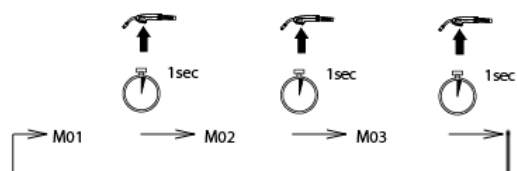

6.7 MIG Special Proceses

The APT+ has a number of special processes which can be selected from the front panel after the other selections have been made by toggling through using the button

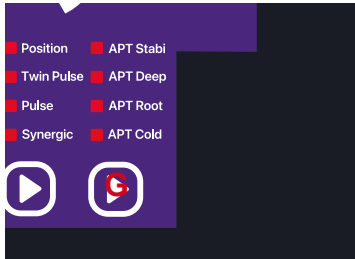


Position

This mode is especially for welding vertically. You set the process by focussing on the wire speed and setting the machine in accordance with the following guide .

1st Pass set the wire speed around 3m/min weld up hill using a triangle movement. The machine will alternate the power output between the set level and a lower level allowing time for the material to cool and solidify.

After completing the first pass if a second pass is required the wire feed rate can be increased to around 4m/min.

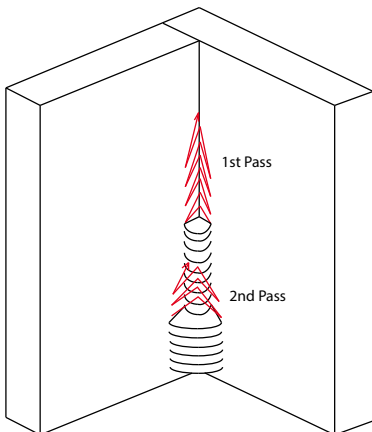

APT+ Cold

This program reduces the heat input into the job allowing thinner materials to be welded without distortion. The process works at 5.0m/min or lower wire feed speeds.

APT+Root

This short arc process is specifically for root runs where the internal bead profile is important, but give increase speed when compared with TIG welding. I has excellent gap bridging. Works with feed speeds of less than 8m/min

APT+ Deep

Gives excellent welding performance with excellent bead profile. It provides a flat weld surface and symmetrical weld seam even on heavily oxidized or contaminated sheets. Weld penetration is improved reducing edge preparation and allowing higher travel speeds. Works with wire speeds of greater than 8.5m/min

APT+Stabi

Ensures consistent energy input when the arc length cannot be controlled due to joint configuration. The resulting welds are consistent in profile and heat input despite a variation in the tip to work piece distance.

6.8 Trimming the Arc to suit your application.

Voltage trim

to trim the preset voltage up or down (after making you program selections) Rotate the Right hand knob left or right to increase or decrease the welding voltage


- V = Shorter Arc reduced welding Voltage

+V = Longer arc increase welding voltage


0= Factory JOB setting

Inductance/ Dynamic correction

In synergic welding mode this control works to control the short circuit transfer current. Referring to the illustration below. If the value is increased then the rise of the short circuit current is slowed and produces a softer smoother arc but with a reduced travel speed. Decreasing the value allows the current to rise faster resulting in higher travel speed with a stiffer arc which may produce more spatter.

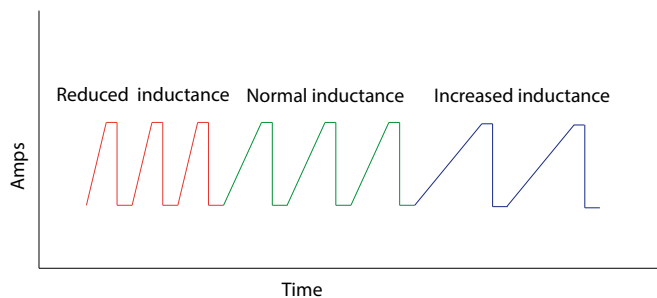


In pulse welding mode the control allows the adjustment of the peak current value for the single pulses that release the wire droplets. Increasing the value increases the pulse current by up to 100A and decreasing the value reduces the pulse current by up to 100A

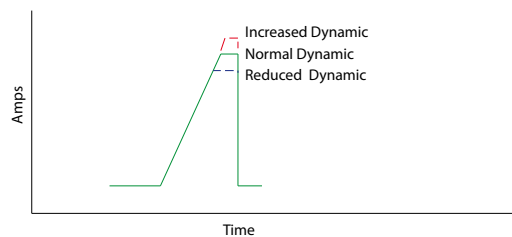

To trim, press the job button to toggle until; the ARC force LED is on. Rotate the Right hand knob left or right to increase or decrease the correction 0= Factory JOB setting +/- 50

Pulse Balance Adjustment

The standard preset double pulse function should be suitable for all applications but if you need to change the double pulse parameter you can do so as detailed below

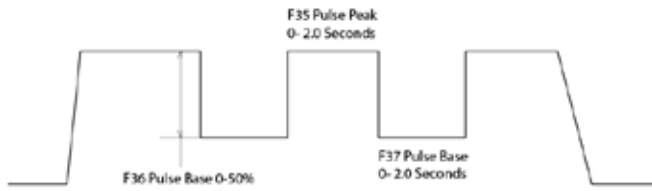

Using the F functions F35, F36, F37 and F38

F08 is the time spent and the peak (normal) power level and can be adjusted from 0 to 10/0 Seconds. Increasing this parameter will give increased heat input and a wider spread of the weld pool.

F11 is the difference between the normal power level and the low power level. It can be adjusted from 0 to 100% at 50% the low power level will be 50% less than the normal power level.

F10 is the time spent and the base (low) power level and can be adjusted from 0 to 10 Seconds. Increasing this parameter will give reduced heat input

F12 is the voltage trim for the base current level and can be adjusted +/- 0 to 9.9 volts

6.9 MIG Wire tension

Note:- Check that drive rolls, and torch parts are correct for the wire size and type being used.

1. The optimum idle roll pressure varies with type of wire, wire diameter, surface conditions, lubrication, and hardness. As a general rule, hard wires may require greater pressure, and soft, or aluminium wire, may require less pressure than the factory setting. The optimum idle roll setting can be determined as follows:
2. Press end of gun against a solid object that is electrically isolated from the welder output and press the gun trigger for several seconds.
3. If the wire "bird nests", jams or breaks at the drive roll, the idle roll pressure is too great. Back the adjustment knob out 1/2 turn, run new wire. If the only result was drive roll slippage, loosen the Hand nut on the central connector and pull the gun forward about 6" (15cm) away from the power source. There should be a slight waviness in the exposed wire. If there is not waviness, the pressure is too low. Tighten the adjustment knob 1/4 turn, reinstall the gun cable and repeat the above steps.
4. When triggering, the electrode and drive mechanism are electrically "LIVE" relative to work and ground and remain "LIVE" several seconds after the gun trigger is released.

WARNING

When using an open arc process, it is necessary to use correct eye, head, and body protection.

1. Position wire over joint. The end of the wire may be lightly touching the work.
2. Lower welding helmet, operate gun trigger, and begin welding. Hold the gun so the contact tip to work distance is about 3/8" (10mm).
3. To stop welding, release the gun trigger and then pull the gun away from the work after the arc goes out.
4. When no more welding is to be done, close valve on gas cylinder (if used), momentarily operate gun trigger to release gas pressure and turn off the machine.

NOTE:- These settings are guidelines only. Material and wire type, joint design, fit up, position, shielding gas, etc. affect settings. Produce test welds to be sure they comply to specifications.

Material thickness determines weld parameters.

6.10 Welding circuit calibration.

The welding circuit resistance can vary, which will affect the performance of the machine. The machine can be set to compensate for this. Cut the welding wire flush with the front of the contact tip and remove the outer nozzle. Select F50 from the function menu while holding the contact tip firmly against the work piece. Press the trigger three to five times for approximately 1 second to calibrate the circuit resistance. The correction figure will be shown in the Right Hand display (millivolts). You can adjust this value manually using the right hand knob if required.

7.0 MMA Welding

Output Polarity Connections

Electrode polarity

MMA electrodes are generally connected to the '+' terminal and the work lead to the '-' terminal

The twist connector on the wire feeder is a + outlet.

But if in doubt consult the electrode manufacturer's literature.

7.1 MMA Welding Operation


WARNING

When using an open arc process, it is necessary to use correct eye, head, and body protection.

7.2 MMA VRD

In MMA Welding mode a Voltage reduction circuit is switched on.

as soon as the circuit resistance goes above 200Ohm the Open Circuit Voltage is reduced to 35V. When you attempt to strike and arc the circuit resistance is less than 200Ohm and the full OCV will be restored. for welding to take place.

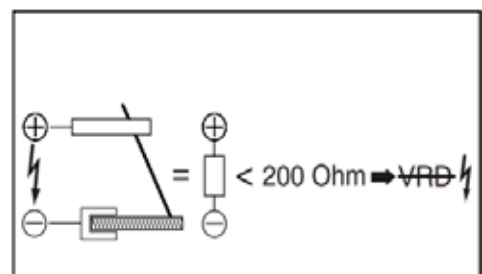

7.3 MMA Welding Guide

Select JOB 7 and the left display will show the amperage and the right display will show EL. You can adjust the welding amperage using the left hand knob (4) you can alter the MMA Arc force, Hot start, Arc Force. Using F70, F71, F72.

Effects of MMA welding various materials

High tensile and alloy steels

The two most prominent effects of welding these steels are the formation of a hardened zone in the weld area, and, if suitable precautions are not taken, the occurrence in this zone of under-bead cracks. Hardened zone and under-bead cracks in the weld area may be reduced by using the correct electrodes, preheating, using higher current settings, using larger electrode sizes, short runs for larger electrode deposits or tempering in a furnace.

Manganese steels

The effect on manganese steel of slow cooling from high temperatures is embrittlement. For this reason it is absolutely essential to keep manganese steel cool during welding by quenching after each weld or skip welding to distribute the heat.

Cast iron

Most types of cast iron, except white iron, are weldable. White iron, because of its extreme brittleness, generally cracks when attempts are made to weld it. Trouble may also be experienced when welding white-heart malleable, due to the porosity caused by gas held in this type of iron.

Copper and alloys

The most important factor is the high rate of heat conductivity of copper, making preheating of heavy sections necessary to give proper fusion of weld and base metal.

Types of electrodes

Arc welding electrodes are classified into a number of groups depending on their applications. There are a great number of electrodes used for specialized industrial purposes which are not of particular interest for everyday general work. These include some low hydrogen types for high tensile steel, cellulose types for welding large diameter pipes, etc. The range of electrodes dealt with in this publication will cover the vast majority of applications likely to be encountered; are all easy to use and all will work on even the most basic of welding machines.

Metals Being Joined and Electrode Comments

Mild steel

6013 ideal electrodes for all general purpose work. Features include outstanding operator appeal, easy arc starting and low spatter.

Mild steel

7014 all positional electrode for use on mild and galvanized steel furniture, plates, fences, gates, pipes and tanks etc. Especially suitable for vertical down welding.

Cast iron

99% nickel suitable for joining all cast irons except white cast iron

Stainless steel

318L-16 high corrosion resistance. Ideal for dairy work, etc.

On stainless steels vertical, lift the torch up from the work piece to draw out an arc. To prevent melting of the end of the tungsten so this in a smooth rapid movement

TIG welding guide ranges.

8.0 Basic TIG Welding Guide


8.1 TIG welding cable connection

Connect the TIG torch to the - terminal and the work lead to the + terminal for direct current straight polarity. Direct current straight polarity is the most widely used polarity for DC TIG welding. It allows limited wear of the electrode since 70% of the heat is concentrated at the work piece. Connect the gas hose on the TIG torch to the gas outlet on the gas regulator. Move the selector switch on the front panel of the machine to the LIFT-TIG position.

8.2 Torch starting in LIFT-TIG mode

To operate in TIG welding mode select JOB 6 on the right control and the left display will show amperage and the right display will show TIG. You can adjust the welding amperage with the left control.

Ensure the gas supply is switched on and gas is flowing from the front of the torch nozzle. Briefly contact the tip of the tungsten electrode down onto the work piece with the torch at around 70° from vertical, lift the torch up from the work piece to draw out an arc. To prevent melting of the end of the tungsten so this in a smooth rapid movement.

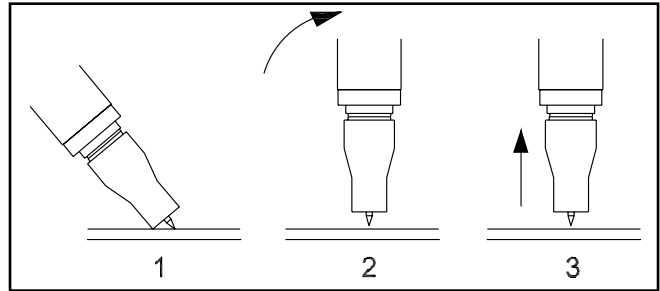

8.3 Additional TIG functions

can be selected as follows (ensure F38 is set to 1 so that they are specific to the TIG Job.

F3 Start time, sets the time that the initial current is held for

F4 Start current sets the value of the starting current as a percentage of the main current

F7 Arc slope up time

F8 TIG Pulse Main current time 0.01 to 10 seconds

F10 TIG Pulse background current time 0.01 to 10 seconds

F11 Background current percentage This must be set at less than 100% for F8 or F11 to have any effect

F15 Down slope time, this is the time for the Current to fall to the level set in F17. F15 is started when the trigger is released

F16 End Time sets the duration of the time spent at the final current (F17)

F17 Final welding current can be set between 1 and 200% of the main welding current.

TIG Welding Guide Ranges

Electrode diameter	DC current (amps)
0.040" (1.0mm)	30 – 60
1/16" (1.6mm)	60 – 115
3/32" (2.4mm)	100 – 165

Tungsten Electrode Types

Electrode type	Welding application	Colour code
Thoriated 2%	DC welding of mild steel, stainless steel and copper. Excellent arc starting, long life, high current carrying capacity.	RED
Ceriated 2%	DC welding of mild steel, stainless steel, copper, aluminium, their alloys longer life, more stable arc, easier starting, wider current range, narrower more concentrated arc	GREY

Guide for Selecting Filler Wire Diameter

Filler wire diameter	DC current range
1/16" (1.6 mm)	20 - 90
3/32" (2.4 mm)	65 - 115
1/8" (3.2 mm)	100 - 165
3/16" (4.8 mm)	200 - 350

The filler wire diameter specified is a guide only, other diameter wires may be used according to the welding application.

Shielding Gas Selection

Alloy	Shielding gas
Aluminium & alloys	Pure Argon
Carbon steel	Pure Argon
Stainless steel	Pure Argon
Nickel alloy	Pure Argon
Copper	Pure Argon
Titanium	Pure Argon

9.0 ARC Air Gouging.

For Arc Air gouging

- 1) Remove the MIG torch
- 2) Insert the grounding cable to the - terminal on the power source
- 3) Insert the power cable connector for the gouging torch into the + connection on the power source.
- 4) Connect the compressed air connection of the arc air gouging torch to the compressed air supply and adjust in accordance with the manufacturers recommendations.
- 5) setup the torch ready to use in accordance with the Manufacturers instructions

6) using the JOB button press and hold for 3 seconds until the display changes and the rotate the RH knob until JOB 7 is selected the RH display will show **6ou** too denote gouging mode

Note the Gouging torch will be live 3 seconds after selecting the JOB, ensure the torch or electrode are not touching any grounded items before selecting the JOB

7) Adjust the required amperage using the left had dial

8) Proceed to gouge in accordance with the manufactures instructions.


9) when the operation is completed select a MIG welding job on the front panel so the torch is no longer live

Note, gouging uses high currents it may be necessary to upgrade the work return lead to perform gouging operations

10.0 Additional Functions

10.1 Memory function

APT+ is equipped with a 99 job memory to save and recall your favourite or customised jobs. and adjustment of welding parameter is automatically saved to memory. To recall a job from memory or change the current memory in use press the Job button repeatedly until the PROG LED is on. Then rotate the right hand knob to change the selected memory in use

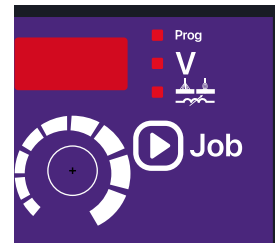

You can change the way F function adjustments are saved using F38 (press F button for 3 seconds)


With F38 set as 0 Any F value that affects the welding will be applied globally across the machine for every job.

If F38 is set to 1 then adjustment of and F value only affects the JOB that is active at the time. This especially useful for TIG and Tack/ Stitch functions.

10.2 Supervisor Lock

It is possible to set the machine in lock mode so that the operator can only use the machine with the current settings. To activate the lock function first program the machine as required for the user and then follow the following steps to activate the lock.

press the S and F button at the same time until the VRD light flashes. the right hand display will show P0 rotate the right hand knob until P1 is displayed Panel lock is now on. The display will return to welding mode after a few seconds. To remove the lock repeat the process and return the setting to P0

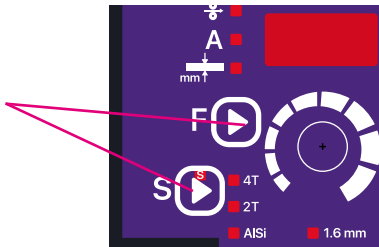

10.3 Sleep Mode

After a period of inactivity the machine will enter sleep mode to save power, the control panel LED will switch off and the 2 display will show a single horizontal bar. To wake up the power source press the torch trigger briefly

11.0 Function List

Function Number		Value Range	Description
F1	Pre gas flow	0-10 Seconds Default is 0.1	Gas pre-flow time before arc start
F2	Start Ignition Mode	0,1,2 Default is 1	0-Wire feeds at full speed to start. 1-Soft feed program starts when the trigger is pressed and then switches to full speed once the arc strikes 2- Soft feed program starts when the trigger is pressed and then ramps to full speed once the arc strikes. preferred for AL and CU wires
F3	Start Time	0-10 Seconds	Works with F4,5,7 regulates the time for the initial current
F4	Start Amperage	1-200%	Start current in MIG mode F3,5,7 usually set over 100% to give a hot start.
F5	Start Arc Correction	-9.9 to +9.9 V	Arc voltage trim during F3 time
F7	Start Slope	0-5 Seconds	slope up time during ignition mode 2 (F3,4,6)
F8	Double Pulse peak time	0.01 -10 Sec	Time for the high current level of double pulse (only needs manual adjustment in TIG mode)

Function Number		Value Range	Description
F10	Double Pulse base time	0.01 -10 Sec	Time for the low current level of double pulse level (only needs manual adjustment in TIG mode)
F11	Double pulses base current level	1-100%	Percentage of main current. in order for double pulse to function this needs to be less than 100% (only needs manual adjustment in TIG mode)
F12	Double pulse arc correction	-9.9 to +9.9 V	Arc trim for base current level in MIG mode
F15	Downslope time	0-10 Seconds	Time for current ramp down in S4T trigger mode or in TIG mode
F16	End time	0-10 Seconds	Time for final current in S4T Mig mode
F17	End Current	1-200%	Level of the final current in S4T MIG mode
F18	End current arc correction	-9.9 to +9.9 V	Arc trim for final current level in S4T MIG mode
F20	Burn back adjustment	10-200	Higher number shortens the wire stick out.
F21	Wire cutting mode	0,1,2 Default is 2	0- Wire feed stops immediately arc is switched off 1- Wire wire feeds until it touches the job to burn off the last droplet. Good for Fe CrNi 2-Wire stops and power pulsed in accordance with F20
F22	Post gas time	0-10 seconds	time gas continues after welding has stopped (MIG)
F23	Smart Trigger function	OFF- ON	When on allows memory recall from torch trigger (toggles Mem 01-02-03)
F24	Penetration Stabilisation	0-5 Default 2	sets the limits for allowable wire speed variation, in order to maintain constant voltage in STABIL PROGRAM Higher number allows greater variation.
F25	Hot start Time	0-10 seconds	How long the machine will deliver a start current for in MMA mode
F26	Hot start Amperage	1-200%	Percentage of the main current for hot start (MMA)
F27	Arc Force	-50 to +50%	Current increase when arc is shortened (MMA)
F28	Antistick	0-2 Seconds	Duration of reduced current when the electrode is in danger of sticking (MMA)
F29	VRD Function	0-1	Voltage reduction device 1=On reduced OCV during idling. (MMA)
F31	TIG V stop limit	10-30 Volts	Point at which the arc cuts out as the torch is lifted (TIG)

Function Number		Value Range	Description
F32	TIG Comfort stop tol	-2 to +2 Volts	Tolerance for triggering the comfort stop function
F34	Tack/Stitch Mode	0-2	0= Off 1= Tacking After trigger is pressed arc burns for duration of F8 value. to restart release trigger and press again when ready 2= Stitch mode: Depress trigger the arc burns for the duration of F8, then stops for duration of F09, and repeats until trigger is released.
F35	Cooling mode	0, 1,2,3,4 Default 0	0 is Cooler is available on demand , 1 Cooler is disabled 2 Cooler runs constantly 3. Cooler Disabled power source fan runs constantly 4 cooler and power source fan run constantly
F36	Motor current	Amps	Display of the actual feed motor current draw
F37	Motor current limit	0.7-7Amps	Set top limit for maximum current draw on wire feed motor
F38	F save, F Reset	0, 1	F function behaviour 0= Where a background parameter is adjusted (F parameter) it is applied to every job saved To reset F functions to factory default display F38 and the hold F button for 3 seconds, 1=Where a background parameter is adjusted (F parameter) it is saved specific to the job number.
F39	Motor control Firmware	-	Shows version number of Motor control board
F40	Power control Firmware	-	Shows version number of power control board
F41	Arc on Time	- Hrs	Arc hours to date
F42	Machine on Time	- Hrs	Power on time to date
F50	Load Resistance calibration	0-30 mOhm	resistance calibration of welding circuit.

12.0 Fault Finding

Problem	Cause/Corrective Action
Porosity - small cavities or holes. Resulting from gas pockets in weld metal.	<p>Inadequate shielding gas coverage. Check for proper gas flow rate.</p> <p>Remove spatter from gun nozzle.</p> <p>Check gas hoses for leaks.</p> <p>Eliminate drafts near welding arc.</p> <p>Place nozzle 6-13 mm from work piece Hold gun near bead at end of weld until molten metal solidifies.</p> <p>Wrong gas. Use welding grade shielding gas; change to different gas.</p> <p>Dirty welding wire. Use clean, dry welding wire. Eliminate pickup of oil or lubricant on welding wire from feeder or liner.</p> <p>Work piece dirty. Remove all grease, oil, moisture, rust, paint, coatings, and dirt from work surface before welding. Use a more highly deoxidizing welding wire (contact supplier).</p> <p>Welding wire extends too far out of nozzle.</p> <p>Be sure welding wire extends not more than 13 mm beyond nozzle.</p>

Problem	Cause/Corrective Action
Incomplete fusion to base metal.	<p>Work piece dirty. Remove all grease, oil, moisture, rust, paint, coatings, and dirt from work surface before welding.</p> <p>Insufficient heat input. Select higher voltage range and/or adjust wire feed speed.</p> <p>Improper welding technique. Place stringer bead in proper locations) at joint during welding.</p> <p>Adjust work angle or widen groove to access bottom during welding.</p> <p>Momentarily hold arc on groove side walls when using weaving technique.</p> <p>Keep arc on leading edge of weld puddle. Use correct gun angle of 0 to 15 degrees.</p>
Excessive Penetration – weld metal melting through base metal and hanging underneath weld.	<p>Excessive heat input. Select lower voltage range and reduce wire feed speed.</p> <p>Increase travel speed.</p>
Lack Of Penetration - shallow. Fusion between weld metal and Base metal.	<p>Improper joint preparation. Material too thick. Joint preparation and design must provide access to bottom of groove while maintaining.</p> <p>Proper welding wire extension and arc characteristics.</p> <p>Improper weld technique. Maintain normal gun angle of 0 to 15 degrees to achieve maximum penetration. Keep arc on leading edge of weld puddle. Ensure welding wire extends not more than 13 mm beyond nozzle.</p> <p>Insufficient heat input. Select higher wire feed speed and/or select higher voltage range.</p> <p>Reduce travel speed.</p>
Burn-Through - weld metal melting. Completely through base metal. Resulting in holes where no metal remains.	<p>Excessive heat input. Select lower voltage range and reduce wire feed speed.</p> <p>Increase and/or maintain steady travel speed.</p>

Problem	Cause/Corrective Action
Excessive Spatter - scattering of Molten metal particles that cool to solid form near weld bead.	<p>Wire feed speed too high. Select lower wire feed speed.</p> <p>Voltage too high. Select lower voltage range.</p> <p>Electrode extension (stick out) too long. Use shorter electrode extension (sick out).</p> <p>Work piece dirty. Remove all grease, oil, moisture, rust, paint, undercoating, and dirt from work surface before welding.</p> <p>Insufficient shielding gas at welding arc. Increase flow of shielding gas at regulator/flow meter and/or prevent drafts near welding arc.</p> <p>Dirty welding wire. Use clean, dry welding wire. Eliminate pickup of oil or lubricant on welding wire from feeder or liner.</p>
Wire feed unit operates but no gas flow.	<p>Gas cylinder empty.</p> <p>Gas regulator closed.</p> <p>Faulty solenoid.</p> <p>Restriction in torch cables.</p>
Wire feed unit operates, but does not feed.	<p>Insufficient drive roll pressure.</p> <p>Incorrect drive rolls.</p> <p>Excessive wire spool brake tension.</p> <p>Incorrect liner.</p> <p>Blocked liner.</p> <p>Bird nesting.</p> <p>Burn back.</p>
Bird nesting.	<p>Excessive feed roll pressure.</p> <p>Incorrect or blocked liner.</p> <p>Incorrect contact tip size.</p> <p>Contact tip overheating.</p> <p>Restriction in torch cable.</p> <p>Misaligned drive rolls or wire guides.</p> <p>Excessive cable kinkage.</p>
Burn back.	<p>Improper voltage setting.</p> <p>Improper stick out.</p> <p>Erratic wire feed.</p> <p>Incorrect or blocked liner.</p> <p>Contact tip overheating.</p> <p>Excessive cable kinking.</p>

Problem	Cause/Corrective Action
Erratic Wire Feeding or Arc.	Improper drive roll tension. Improper drive roll size. Worn drive rolls. Incorrect or blocked liner. Incorrect wire guide size. Misaligned drive rolls or wire guide. Gaps at liner or wire guide junctions. Incorrect contact tip size. Contact Tip overheating. Spatter adhesion on exit geometry of tip bore. Excessive cable kinkage. Poor earth or cable connections. Weld joint area dirty.
Yellow temperature light illuminates.	Power source has over heated leave the machine running to allow it to cool down. Ensure entry and exit vents on machine are clear and machine has a good supply of cooling air. Reduce operating duty cycle and or amperage.

13 Repair and Maintenance

DANGER Improper maintenance and use!

The machine may only be cleaned, repaired or controlled by qualified, trained persons!

The competent person is the person who knows the dangers and potential damages that occur in these machines through his training, knowledge and experience and can take the necessary safety measures.

- Perform all checks in the following section!
- Restart the machine only after successful maintenance.

Risk of injury from electric shock!

Work on machines not disconnected from the electrical supply can cause serious injury!

- Safely disconnect the machine from the electrical supply.
- Disconnect the mains connector!
- Wait 4 minutes until the condensers are empty!

Repair and maintenance work must only be carried out by trained and authorized specialist personnel, otherwise the warranty is void. Contact your authorized dealer or the supplier of the device for any service issues. Refunds for warranty claims can only be made through your authorized dealer. Only original spare parts should be used for parts replacement. When ordering spare parts, the machine type, serial number and model number of the machine, type identification and product number of the spare part must be specified.

General

This device is largely maintenance-free and requires minimal cleaning under normal operating conditions. In order to ensure that the welding machine operates flawlessly, it is still necessary to pay attention to some points. This includes regular cleaning and maintenance of the welding machine depending on the degree of contamination from the environment and the duration of the welding machine.

Maintenance intervals

Daily Maintenance

- Check that all connections and moving parts are secure, tighten if necessary.
- Wire feed rollers must be cleaned regularly

Visual control

- Check the hose package and the power connections for external damage and replace if necessary or have them repaired by qualified personnel!
- Main power supply and connection plug
- Gas hoses

Operation checks

- Check that the wire coil is properly fixed.
- Welding cables check firm, locked position
- Gas cylinder regulators and securing straps

Monthly maintenance work

Visual control

- Body damage (front, rear and side walls)
- Wheels security and operation
- Check the coolant hoses and their connections for leaks

Operation control

- Check Selector switches, power isolators, voltage reduction devices, warning and control lamps
- Check whether the wire feed elements are secure

Annual inspections (inspection and inspection during operation)

Inspection of the welding machine may only be carried out by qualified and authorized persons. The expert is the person who knows the hazards and potential damages in the source power sources with his / her education, knowledge and experience and is able to take the necessary security measures.

13.1 Error Codes

Resetting All errors Press F (button 3) on the front panel until the memory display shows 10.

Error Code	POSSIBLE CAUSES	SOLUTION
E1	Input Phase Failure	Check input voltage and wires in plug, check input cable for damage, check fuses at rear of machine inform the authorized service if there are any problems.
E4	Transformer Thermal Error	Ensure that the Power Unit Fan is operating. Wait 15-20 minutes without welding (machine on). . The power lamp may be faulty. Turn the On-Off switch to the "ON" position If the problem persists, notify the Authorized Service centre.
E5	IGBT Thermal Error	Ensure that the Power Unit Fan is operating. Wait 15-20 minutes without welding (machine on). If the problem persists, notify the Authorized Service.
E6	Diode Thermal Error	Ensure that the Power Unit Fan is operating. Wait 15-20 minutes without welding (machine on). If the problem persists, notify the Authorized Service.
E8	E8 Front panel Card Data Receive Error	Front Panel Board Cannot Communicate with Motor Card. Check Socket and interconnect Cables. If the problem persists, notify the Authorized Service.
E9	Motor Card Receiving Data Error	Check Sockets And Cables Between Motor Board And Front Panel Board.
		Check Communication Cable Between Intermediate Hose Package and Wire Feeding Unit.
E10	Control card Receiving Data Error	The Control Card in the power unit cannot receive data. Check the Voltage and Ports of the cables.
		Check Communication Cable Between Intermediate Hose Package And Wire Feeding Unit.
E12	High Current Error Protection	Check between the + and - poles of your machine to ensure no short circuit. Wait 20 minutes, if Error changes to Error1 check all input phases are present.
E14	High Current Error Protection	Ensure no short circuits, Check IGBT,+ Output Diode are OK Replace control card Investigate Power PC.
E20	Robot interface data error	occurs when the robot board cannot communicate with the control board
E30	High Feed motor current	occurs when the motor current exceeds the motor current limit
E40	Memory read Write error	Occurs when the panel couldn't read or write the values. When this error occurs, the panel will reset after 5 seconds to be able to read/write again

14.0 Accessories

8.1 Gas Equipment

Everyday Gas Regulators – 300 BAR

Single Stage

Features

Flow rate up to 96m³/h (3389 ft³/h)

- Full 300 bar capability
- Outlet pressure indicated on the bonnet
- Bottom entry design suited for top outlet cylinder valves

Fittings

- Fitted with standard 3/8" BSP outlet
- Fitted with 5/8" BSP inlet connections



Stock Code	Description	Max. Outlet Pressure
E700140	Argon Preset Regulator	3.0 Bar
E700141	Argon Indicator Regulator	3.0 Bar
E700113	1 Gauge Argon	30 lpm flow
E700123	2 Gauge Argon	30 lpm flow

Flow Meters

Features

- Designed from brass bar whilst the tube and cover are moulded from high quality polycarbonate to ensure high impact resistance and clarity
- Calibrated to operate at an inlet pressure of 30PSI
- Sensitive needle valve provides easy adjustment and the downward facing outlet connection eliminates hose kinking.



Fittings

- Fitted with standard 3/8" BSP
- Inlet and outlet connections

Stock Code	Description
706101	Flow Meter Mixed Gas 25 lpm (MIG)

Gas Flow Tester

- Designed to check gas flow at the front of MIG Torches.

Stock Code	Description
806001	Gas flow tester



8.2 Feed Rolls

Part No	Description	Application
DR7V0810	D/ROLL 0.8-1.0 V GROOVE	0.8-1.0 Hard Wires
DR7V1012	D/ROLL 1.0-1.2 V GROOVE	1.0-1.2 Hard wires
DR7V1216	D/ROLL 1.2-1.6 V GROOVE	1.2-1.6 Hard wires
DR7U0810	D/ROLL 0.8-1.0 U GROOVE	0.8-1.0 Soft wire
DR7U1012	D/ROLL 1.0-1.2 U GROOVE	1.0-1.2 Soft wire
DR7U1216	D/ROLL 1.2-1.6 U GROOVE	1.2-1.6 Soft wire
DR7K1216	D/ROLL 1.2-1.6 K GROOVE- F/COR	1.2-1.6 Cored wire
DR7K2428	D/ROLL 2.4-2.8 K GROOVE- F/COR	2.4-2.8 Cored wire

15 EC Declaration of Conformity

Hereby we declare that the machines as stated below

Type: APT+M220CW
APT+M220C

Conform to the EC Directives:
Low Voltage Directive 2014/35/EEC
EMC Directive 2014/35/EEC

Harmonised European standard: EN/IEC 60974-1

This is to certify that the tested sample is in conformity with all provisions of the above detailed EU directives and product standards.



15.1 RoHS Compliance Declaration

Directive 2011/65/EU of the European Parliament
Amended 2015/863 and 2017/2102

Restriction of use of certain hazardous substances in electrical and electronic equipment

Type: APT+M220CW
APT+M220C

The above listed products are certified to be compliant with the RoHS directive with all homogeneous component parts being controlled to ensure material contents as per the list below.

Cadmium 0.01% by weight
Lead 0.1% by weight
Mercury 0.1% by weight
Hexavalent chromium 0.1% by weight
Polybrominated biphenyl's (pbbs) 0.1% by weight
Polybrominated diphenyl ethers (pbdes) 0.1% by weight

It should be noted that under specific exempted applications, where lead is used as an alloying element the following limits are applied in accordance with the regulations.


Copper and copper alloy parts use less than 4% by weight of each homogeneous component.

Steel and steel alloy parts use less than 4% by weight of each homogeneous component.

Aluminium and aluminium alloy parts use less than 4% by weight of each homogeneous component.

Only dispose off in authorised sites for electrical and electronic waste do not dispose of with general refuse or landfill waste.

15.2 WEEE Statement

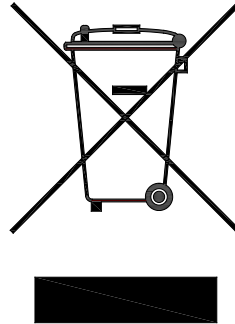

WEEE (Waste Electrical & Electronic Equipment) 2012/19/EU

In relation to implementing the legislation, Parweld has established relevant recycling and recovery methods. We have been fully compliant against the marking requirements since August 2005. Parweld is registered in the UK with the Environment agency as detailed below. For WEE compliance outside the UK please contact your supplier/Importer

Parweld is registered with a compliance scheme Official registration number is WEE/FD0255QV

When your equipment reaches the end of its service life you should return it to Parweld where it will be reconditioned or processed for recycling.

15.3 Statement of Warranty

Limited Warranty:

Parweld Ltd, hereafter, "Parweld" warrants its customers that its products will be free of defects in workmanship or material. Should any failure to conform to this warranty appear within the time period applicable to the Parweld products as stated below, Parweld shall, upon notification thereof and substantiation that the product has been stored, installed, operated, and maintained in accordance with Parweld's specifications, instructions, recommendations and recognized standard industry practice, and not subject to misuse, repair, neglect, alteration, or accident, correct such defects by suitable repair or replacement, at Parweld's sole option, of any components or parts of the product determined by Parweld to be defective.

Parweld makes no other warranty, express or implied. This warranty is exclusive and in lieu of all others, including, but not limited to any warranty of merchantability or fitness for any particular purpose.

Limitation of Liability:

Parweld shall not under any circumstances be liable for special, indirect or consequential damages, such as, but not limited to, lost profits and business interruption. The remedies of the purchaser set forth herein are exclusive and the liability of Parweld with respect to any contract, or anything done in connection therewith such as the performance or breach thereof, or from the manufacture, sale, delivery, resale, or use of any goods covered by or furnished by Parweld whether arising out of contract, negligence, strict tort, or under any warranty, or otherwise, shall not, except as expressly provided herein, exceed the price of the goods upon which such liability is based. No employee, agent, or representative of Parweld is authorized to change this warranty in any way or grant any other warranty.

Purchaser's rights under this warranty are void if replacement parts or accessories are used which in Parweld's sole judgement may impair the safety or performance of any Parweld product.

Purchaser's rights under this warranty are void if the product is sold to purchaser by non-authorized persons.

The warranty is effective for the time stated below beginning on the date that the authorized Distributor delivers the products to the purchaser. Notwithstanding the foregoing, in no event shall the warranty period extend more than the time stated plus one month from the date Parweld delivered the product to the authorized distributor.

